



Visual Inspection Paris0002

Un peu de
parylène sur GA4,
gênant pour les
canopies?

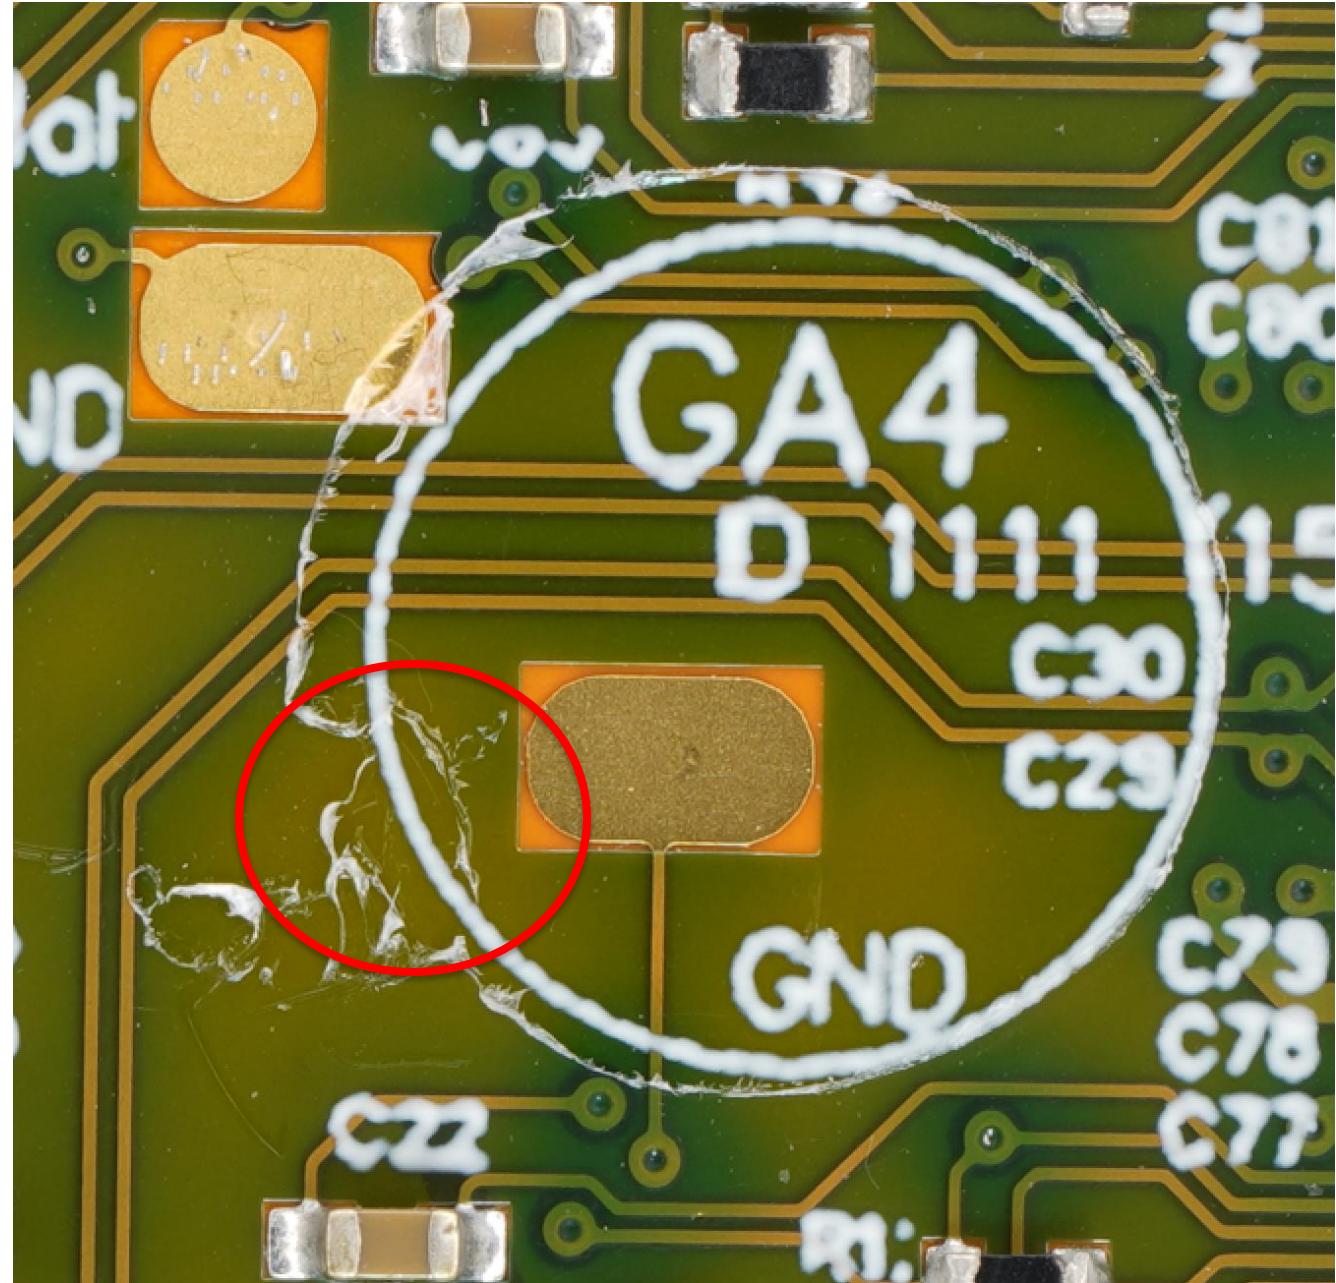

J'ai dis:
Parylène sur le
connecteur,
correct?

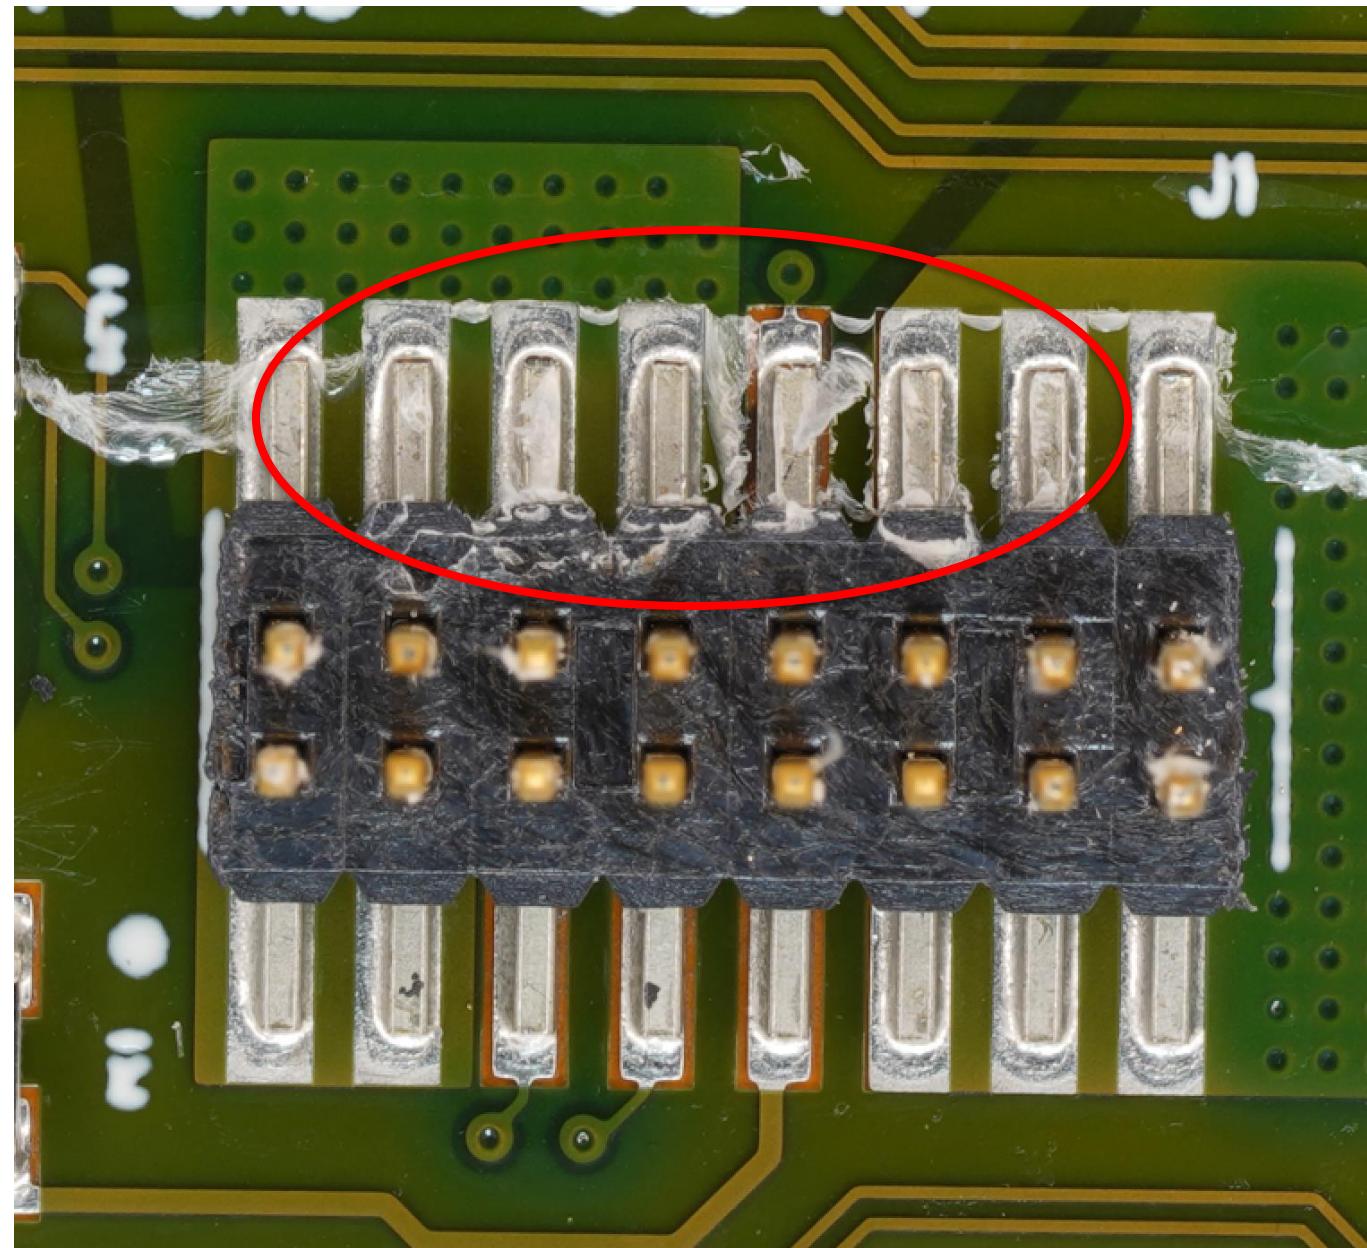



Infiltration de parylène?

**Contamination...
Aucune idée de ce
que ça peut être...**



ATLAS Serial Number:

20UPGM23210017

Component Type:

MODULE

Current Stage:

MODULE/PARYLENE_UNMASKING

TimeStart:

2025-10-06T15:30:54.563619+00:00

Front-side Defects Tile-0:

Yellow.Dusts_PCB

Front-side Defects Tile-6:

Yellow.Dusts_PCB

Front-side Defects Tile-9:

Yellow.Dusts_PCB

Front-side Defects Tile-10:

Yellow.Parylene_on_pickup

Front-side Defects Tile-14:

Yellow.Other_PCB

Front-side Defects Tile-21:

Yellow.Dusts_PCB

Front-side Defects Tile-25:

Yellow.Dusts_PCB

Front-side Defects Tile-26:

Yellow.Parylene_on_connector

Front-side Defects Tile-27:

Yellow.Parylene_on_connector

Front-side Defects Tile-31:

Yellow.Dusts_PCB

Front-side Defects Tile-32:

Yellow.Parylene_on_connector

Front-side Defects Tile-33:

Yellow.Parylene_on_connector

Front-side Comments Tile-10:

A tiny bit on the GA4 round

Front-side Comments Tile-14:

on the left corner: pad with half parylene, other half without parylene

Back-side Defects Tile-0:

Yellow.Dusts_FE

Back-side Defects Tile-1:

Yellow.Dusts_FE

Back-side Defects Tile-2:

Yellow.Dusts_FE

Back-side Defects Tile-3:

Yellow.Dusts_FE

Back-side Defects Tile-4:

Yellow.Dusts_FE

Back-side Defects Tile-5:

Yellow.Scratches_FE,Yellow.Dusts_FE

Back-side Defects Tile-9:

Yellow.Scratches_FE

Back-side Defects Tile-10:

Yellow.Dusts_FE

Back-side Defects Tile-11:

Yellow.Dusts_FE

Back-side Defects Tile-12:

Yellow.Parylene_intrusion

Back-side Defects Tile-13:

Yellow.Parylene_intrusion,Yellow.Scratches_FE

Back-side Defects Tile-14:

Yellow.Scratches_FE

Back-side Defects Tile-15:

Yellow.Dusts_FE

Back-side Defects Tile-16:

Yellow.Parylene_intrusion

Back-side Defects Tile-17:

Yellow.Parylene_intrusion

Back-side Defects Tile-20:

Yellow.Dusts_FE

Back-side Defects Tile-21:

Yellow.Dusts_FE

Back-side Defects Tile-22:

Yellow.Dusts_FE

Back-side Defects Tile-23:

Yellow.Dusts_FE

Back-side Defects Tile-24:

Yellow.Dusts_FE

Back-side Defects Tile-26:

Yellow.Parylene_intrusion,Yellow.Dusts_FE,Yellow.Other_FE

Back-side Defects Tile-27:

Yellow.Parylene_intrusion

Only Yellow with dust/scratches but mostly on Back-side...